UNITED STATES DEPARTMENT OF LABOR MINE SAFETY AND HEALTH ADMINISTRATION

DISTRICT 7

ACCIDENT INVESTIGATION REPORT
(UNDERGROUND COAL MINE)
NON-FATAL COAL OUTBURST ACCIDENT
NO. 37 MINE (I.D. NO. 15-04670)
ARCH OF KENTUCKY, INCORPORATED
CUMBERLAND, HARLAN COUNTY, KENTUCKY

MAY 8, 1989

BY

JAMES W. POYNTER
COAL MINE SAFETY AND HEALTH INSPECTOR

ORIGINATING OFFICE - MINE SAFETY AND HEALTH ADMINISTRATION HC 66, BOX 1762, BARBOURVILLE, KENTUCKY 40906

JOSEPH J. GARCIA, DISTRICT MANAGER

REPORT OF INVESTIGATION (UNDERGROUND COAL MINE)

NON-FATAL COAL OUTBURST ACCIDENT NO. 37 MINE (I.D. NO. 15-04670) ARCH OF KENTUCKY, INCORPORATED

CUMBERLAND, HARLAN COUNTY, KENTUCKY

MAY 8, 1989

REPORT OF INVESTIGATION (UNDERGROUND COAL MINE)

NON-FATAL COAL OUTBURST ACCIDENT NO. 37 MINE (I.D. NO. 15-04670) ARCH OF KENTUCKY, INCORPORATED

CUMBERLAND, HARLAN COUNTY, KENTUCKY

MAY 8, 1989

GENERAL INFORMATION

The No. 37 Mine of Arch of Kentucky, Incorporated is located one mile south of U.S. 119 on Cloverlick Road, Cumberland, Harlan County, Kentucky. The mine began operation on or about October 1, 1980. The mine produces coal with four shifts per day, five days per week, with two-hundred-thirty-five underground employees and forty-seven surface employees.

The mine is a multi-unit mine with two advancing units and one longwall unit, in production at this time. The advancing units utilize three to five entry systems with Joy 12CM Continuous Miners, Joy 10SC shuttle cars, Fletcher or Galis roof bolters and S&S scoops. The longwall unit utilizes a Mitsui Trojan 700 shearer, one-hundred-four Westfalia shields, and a Halbach-Braun stage-loader automatic face conveyor system across a five-hundred foot working face. All units utilize belt conveyor coal haulage. Track haulage is used for mantrip and supply via battery and/or trolley or diesel-powered vehicles. The mine has a daily production of ten-thousand tons.

Principal Mine Officials are:

Tom J. Sawarynski Danny Stickel Kenneth R. McCoy President
Superintendent No. 37 Mine
Manager Safety & Employee
Development

The Roof Control Plan, approved June 20, 1988, provides for overhead support in all roof spans. The minimum entry width is twenty feet, developed with a minimum distance of sixty feet between the centers of entries, crosscuts and rooms. Rods, fully grouted with polyester resin are used on advancing sections. The minimum length of rods is thirty-six inches with installation on forty-eight inch centers. Tensioned rebar combination bolts, with twenty-four inches minimum grouting, are also approved for use. Tensioned rebar bolts have a minimum length of forty-eight inches, installed on forty-eight inch centers. The retreating longwall section provides for full overhead support utilizing four-leg hydraulically powered "shields" with one-hundred-fiftyfour tons yield capacity per leg. Shields are equipped with extensible plates for skin-to-skin protection on the roof beam and caving shield and forepole extension to provide immediate support behind the shearer.

A supplement to the Roof Control Plan was approved to require modification of operating procedures in potential bump areas. This plan requires minimizing the distance the headgate is in front of the tailgate; closely monitoring the gob overhanging to

evaluate potential burst/bump conditions; monitor face rate advance; limit the number of people at the shearer in potential bump areas; operators and propmen will be required to operate the machine remotely from No. 85 shield to No. 104 shield; and No. 85 through No. 104 shields will be advanced as soon as the full face web is cut.

Studies are being conducted by the USBM to assist in developing a comprehensive coal and rock burst plan.

The last regular Health and Safety Inspection was completed March 31, 1989.

DESCRIPTION OF ACCIDENT

Monday, May 8, 1989 at 1:00 a.m., the 004 section crew of nine persons entered the mine by diesel mantrip and traveled to the working section. The section crew met at the dinner-hole and a safety meeting was held by Ralph Price, Section Foreman. The work assignments were given by Price and the crew proceeded to the face. The shearer was located at the No. 50 shield, headed toward the headgate. The shearer was taken back across the face, to the tailgate, to straighten the pan. Coal production began at approximately 2:00 a.m., due to a delay in starting the main conveyor belts.

Ronnie Dudash and Johnny Thompson (injured), Tailgate and Headgate-side Shearer Operators, respectively, were making the cut-out at the tailgate of the third pass when the outburst occurred. Dudash was advancing the shearer, by radio remote, at the No. 99 shield. Thompson was located in the walkway of the No. 91 shield. Robert Knoll, Propman, was positioning the pan at the No. 79 shield. Dudash was knocked backward over the shield's controls, he began searching for Thompson but was unable to find him. Dudash called to Knoll, who was proceeding toward the shearer, to contact Price on the mine telephone. Knoll informed Price of the outburst and proceeded to the shield where Dudash was removing the loose coal from around Thompson. Thompson had been pushed back between the Nos. 90 and 91 shields and partially covered from the chest down by loose coal. Shortly thereafter, the remaining crew; foreman; and propmen arrived and assisted Dudash and Knoll in removing the loose coal.

Knoll questioned Thompson about his injuries and cleaned the coal dust from his face and mouth. Thompson, complaining of pain in his right side, was placed on a stretcher and carried to the diesel-powered mantrip and transported to the surface. Thompson was transferred to the company ambulance and transported to the Harlan Appalachian Regional Hospital, Harlan, Kentucky. He was later transported by helicopter to the Holsten Valley Community Hospital, Kingsport, Tennessee, for further treatment.

PHYSICAL FACTORS INVOLVED

The investigation revealed the following factors relevant to the occurrence of the accident:

- 1. The mine is located in the Harlan coal-seam, one-half mile south of Cumberland, Harlan County, Kentucky. The immediate roof, throughout the mine, normally consists of ten feet, or more, siltstone and the main roof consists of ten feet, or more, sandstone. Coal is extracted from the longwall face by a Mitsui Trojan 700 ripper-type shearer. The roof, across the longwall face, is supported by Westfalia four-leg shields with one-hundred-fifty-four tons per leg yield capacity. Mined coal is transported across the five-hundred foot face by a Halbach-Braun (H & B) conveyor pan-line.
- 2. The headgate and tailgate entries, for the affected panel, were developed as three-entry systems on one-hundred-twenty feet centers between crossouts, eighty-five feet centers between Nos. 1 and 2 entries, and one-hundred-thirty-five feet centers between Nos. 2 and 3 entries.
- The longwall panel (total length approximately seventhousand-five-hundred feet) had been mined approximately one-thousand-five-hundred feet to where mining ceased due to a sandstone roll at the No. 49 crosscut. The unit was moved to the No. 42 crosscut, a distance of approximately eight-hundred-forty feet.
- 4. The longwall unit had advanced approximately two-thousand-four-hundred feet from the No. 42 crosscut to where an outburst occurred at crosscut No. 22 on April 12, 1989.
- 5. The longwall panel has advanced approximately six-hundred feet from that point to where this outburst occurred.
- 6. The total amount of overburden, at the scene of the accident, was approximately one-thousand-two-hundred-fifty feet.
- 7. Mining was completed in November, 1988, in the adjacent area (tailgate side) between the Nos. R-16 and R-22 entries.

- 8. An area of soft, broken floor was observed from the No. 73 shield to the No. 79 shield, a distance of twenty-five feet.
- 9. Evidence of excessive loading was observed in the No. 2 entry of the R-16 (tailgate) entries, approximately one-hundred-seventy feet outby the longwall face. The coal pillars were crushed out and the mine floor had heaved.
- 10. Evidence of lateral shift caused by roof pressure was observed in the No. 1 entry of the R-16 (tailgate) entries, in an area beginning approximately one-hundred-twenty feet outby the longwall face. Of the two rows of four-feet-square cribs installed, on twelve feet centers maximum, in the entry, the row opposite of the longwall panel, exhibited a sixteen-inch lateral shift (eight degrees from vertical). The adjacent row remained in a vertical position.
- 11. The immediate roof, laminated shale and sandstone, had caved to a height of approximately fourteen feet on the headgate end of the longwall gob area and approximately twelve feet on the tailgate end. The main (sandstone) roof, was observed above the fallen material at both locations.
- 12. Approximately one-hundred tons of material was broken or expelled from the coal face, affecting an area approximately fifty-five feet in length, nine feet in height, and five feet (average) in depth.
- 13. The force of the outburst elevated the face side of the shearer machine, ten inches higher than the shield side. Loose coal was expelled from the face area and was up to thirty-six inches deep along the walkway in the shields beginning at the No. 88 shield and extending to the No. 93 shield, a distance of approximately forty feet.
- 14. The most severely affected area of the coal face was in the vicinity of the headgate-end ripper-drum. This area was approximately fifty-eight feet from the No. 1 tailgate entry and extended for approximately twelve feet beyond the drum.
- 15. The headgate and tailgate-side shearer operators, were positioned at the Nos. 91 and 92 shields, respectively.
- 16. On April 12, 1989 a coal outburst occurred on the longwall face. This occurred approximately 600' inby the location of this occurence.

CONCLUSION

It was the consensus of the investigating committees that the accident occurred because significant caving had not occurred inby the longwall unit to relieve the pressure across the working face. The pressure was created by massive consolidated sandstone roof across this area of the R-9, R-16 and R-22 entries and the failure of the abutment pillars from excessive loading.

VIOLATIONS

- I. A 103-K Order, No. 3172273, was issued May 8, 1989, for the purpose of investigation into the injury related accident.
- II. A 107-A Imminent Danger Order, No. 3174493, was issued May 8, 1989, to prevent persons from producing coal in the affected area until a plan for controlling the outbursts of coal is approved by the District Manager.
- III. A 104-A Citation, No. 3174494, was issued, as the operator failed to comply with the approved roof control plan because the headgate-side shearer operator was positioned between the Nos. 85 and 104 shields, while the shearer was in operation, a violation of 75.220, 30 CFR.
- IV. A 104-A Citation, No. 3174495, was issued, as the operator failed to comply with the approved roof plan because the tailgate-side shearer operator was positioned between the Nos. 85 and 104 shields, while the shearer was in operation, a violation of 75.220, 30 CFR.

Respectfully submitted,

James W. Poynter

Coal Mine Safety & Health Inspector

Approved by:

Carl E. Boone, II Subdistrict Manager

and

Joseph J. Garcia District Manager

APPENDIX

List of persons furnishing information and/or present during the investigation:

Arch of Kentucky, Incorporated

Danny Stickel

Kenneth R. McCoy

Ralph Price

Ronnie Dudash

D.R. Knoll

Mine Manager

Manager-Employee & Safety

Development

Foreman

Shearer Operator

Propman

United Mine Workers of America

Kenny Johnson

Robert Clay

George Massey

President, Local 7425

Chairman, Health & Safety

Committee

Safety Committeeman

Kentucky Department of Mines and Minerals

Dewey Middleton

David Disney

Ronnie Hampton

District Supervisor

Inspector

Mine Safety Analyst

Mine Safety and Health Administration

Robert Blanton

John G. Gluck

Roof Control &

Ventilation Specialist

Kenneth Fee

Coal Mine Safety & Health

Inspector Supervisor

Education & Training

Specialist

Coal Mine Safety & Health James Poynter

Inspector

Preliminary Report of Accident

U.S. Department of Labor

Coal Mine Inspector



Date

05-10-89

•	Min	e Safety and Heat	th Administration	
This Form is Affected by the Privacy Act of 19	74.			
1. Accident Type	2. Accident Classification		3. Fatal Case Number	
Nonfatal Injury Accident	Fall of Face, Rib	, Side or Hig	ghwa I I	•
4. District	5. Subdistrict		6. Field Office	······································
7	Barbourville		Harlan	
7. Name of Person Preparing Report James Poynter	B. MSHA Person Notified		Date	Time
9. Notifying Mine Person	Jimmie Tankersi		05-08-89	5:45 am
J. R. Estep			10. Telephone Numbe	
11. Mining Company Name	a. Company/Contractor Nam	· · · · · · · · · · · · · · · · · · ·	606-589-2986 b. Parent Company	
Arch of Kentucky, Inc.	N/A			
12. Mine Name	8. Union	13, ID Number	· · · · · · · · · · · · · · · · · · ·	Corporation Primary Mineral Mined
No. 37	Ø Yes □ No	15-04670		Coal
	erground c. Open Pi		Mili/Prep Plant	e. Other
Employees: 282 23	5	·	^	n
16. Number of Persons in		lumber of Persons	· · · · · · · · · · · · · · · · · · ·	
Mine at Time of Accident 45	. U	naccounted for	0	
17. Mine Location: 8. City	b. County		c. State	
Cumberland	Harlan		Kentucky	
18. Date of Accident (month, day & year)	19. Time of Accident (Indica	te a.m/p.m)	20. Date/Time of Dea	sth (month, day & year)
05-08-89	4:15 am		N/A	
21. Mark code which best describes where accid	dent occurred.			22. Mining Height
	08-Dredge Mining	□ 30 – Mill/Pr		
Arms.	07-Advance Mining	☐ 99 – Office	-	108-inches
	J08-Retreet Mining per of Fatal Injuries or	Other (spec	:ιιγ)	
01 Illnes sheets	ses (complete additional N/A for multiple fatals)	6. 1481118		
b. Age c. SSN (lest 4 digits) d. Regu	lar Job Title	e. Job T	itle When injured (if c	lifferent)
				· · · · · · · · · · · · · · · · · · ·
25. Mining a. Total b. With Experience:	Company c. A	Mine	d. On Jo	
26. Autopsy No	a. F	lace		
27. Description of accident, include equipment	involved exect location in mine o	f facality and make a	f recover and annual	
operations, if appropriate. (continue on re		ii iataiity, and status c	ii rescue and recovery	
At 4:15 am, May 8, 1989,	along the longwall	face, beginn	ing at the No	o. 80 shield
and extending to the No. 99 shield, an outburst of coal occurred, resulting in				
injuries to one (1) pers				
			•	
Exact location in the mi	ne was on the 004-0	m.m.u. (long)	wall section)	. located in
the longwall panel betwe	_			•
imately 500-feet long.			•	• •
approximately 24,900-fee		•		
				•
•				
-				
•				
•				
				(continued on reverse []]
28. Equipment Manufacturer		29. Model		
Mitsui		Trojan 7	00	
30. Initial Report 31. Signature		Title		Date

a. Amended Report 🔲

32. Reason for Amendment:

No

U.S. Department of Labor Mine Safety and Health Administration



Section A-Victim Data				· · · · · · · · · · · · · · · · · · ·	
1. Name	2. Sex		3. Social Securi	ty Number	
Johnny Thompson	, KX Male	Female	403-74-1	071	•
4. Age 5. Job Classification)			•	•
37 Shearer Ope	erator	•	•		
6. Experience at this Classification		7. Total Mining Excert	ence		
7 years 3 months	•	ll years, ll	months	•	_
9. What activity was caing partormed at time of a	accident? 9. Vic	um s Experience at this	· · · · · · · · · · · · · · · · · · ·	as victim trained	in this tasi
Shearer Operator .	7 v	ears, 3 months		Yes	•
Section 3-Victim Data for mealth and Safety Co				Date Recei	ved
11.					
Annual Refreshe <u>r Tr</u> aining (1	Underground)			October 17,	1988
12.					
•				•	
13.			······································		
14.					
		•			
<u>.</u>					-
Section C-Supervisor Data (supervisor of victim)					
15. Name		16. Certified			
Ralph Price			No	•	
17. Experience as Supervisor		18. Total Mining Excer	ience		<u> </u>
5 years		15 years, 7	months		
Section D-Supervisor Data for Health and Safety	Courses/Training Received		· · ·	Date Recei	ved
19.					•
Annual Refresher Training (Underground)		·	September 2	6 1099
20.	<u> </u>			ocpccmber. 2	
· Flootrical Defracher Traini				0-4-1	1000
Electrical Refresher Training	ng			October 22,	1988
				•	
22.					···
			•		- ,
23. When was the supervisor last present at accidu accident?	ent scene prior to the	24. What did he do whi	en ne was there?		
3:55 a.m.	-	Observe cutt	ing cycle of s	nearer	
	······································				
			•		•••
25. When was he last in contact with the victim?		26. Did he issue instruc	tions relative to the acc	ident?	<u> </u>
3:55 a.m.		No	•		•
~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~		■ 7 		_	

U.S. Department of Labor Mine Safety and Health Administration



Authority—This report is based on an investigation made pursuant to the Federal Mine Safety and Health Act of 1977, Public Law 91-173, as amended by Public Law 95-164.

Section A-Identification Data .	
1. Title of investigation:	2. Date MSHA investigation started:
Non-Fatal Coal Outburst Accident	5-8-89
3. Report release cate:	4. Mine:
	No. 37
5. Mine ID number:	6. Company:
15-04670	Arch of Kentucky, Inc.
7. Town, Caunty, State:	8. Autnor(s):
Cumberland, Harlan County, Kentucky	James Poynter, John Gluck
Section B—'Mine information	
S. Dany production:	i). Surface employment:
13,10,000	47
11. Underground employment:	12. Name of coalbed:
235	Harlan
13. Thickness of coalbed:	
84 inches	
Section C-Last Quarter Injury Frequency Rate (HSAC) for:	
14. Industry:	15. This operation:
Total Degree 2-5: 12.78	6.98
16. Training program approved:	17. Mine Profile Rating:
05-17-88	N/A
Section D—Originating Office	
18. Mine Sarety and Health Administration	Address:
Coal Mine Health and Safety District No.: 7	HC 66, Box 1762, Barbourville, Kentucky 40906
Section E-Abstract	

A coal outburst occurred at 4:15 a.m., Monday, May 8, 1989, on the 004-0 (Longwall) Section

The longwall shearer was making the cut-out with the shearer approximately 24 feet from the

tailgate entry, when the outburst occurred. One (1) person, Johnny Thompson, head-gate

side shearer operator, received injuries from the outburst. The injured was checked for


injuries by Robert Knoll, Propman and transported to the surface via diesel mantrip. The

injured was then taken to the Harlan Appalachian Regional Hospital and then transported via

helicopter to the Holsten Valley Community Hospital, Kingsport, Tennessee.


Section	F-Mine	Organization
---------	--------	--------------

Company officials:	Name	
19. President:	Tom J. Sawarynski	P.O. Box 787, Lynch, KY 40855
20. Superintendent:	Danny L. Stickel	P.O. Box 787, Lynch, KY 40855
21. Safety Director:	Kenneth R. McCoy	P.O. Box 787, Lynch, KY 40855
22. Principle officer-H&S:	Danny L. Stickel	P.O. Box 787, Lynch, KY 40855.
23. Labor Organization:	UMWA; District 19; Local 7425	P.O. Box B, Cumberland, KY 40823
24. Chairman—H&S	Robert Clay	101 Huff Ave., Cumberland, KY 40823

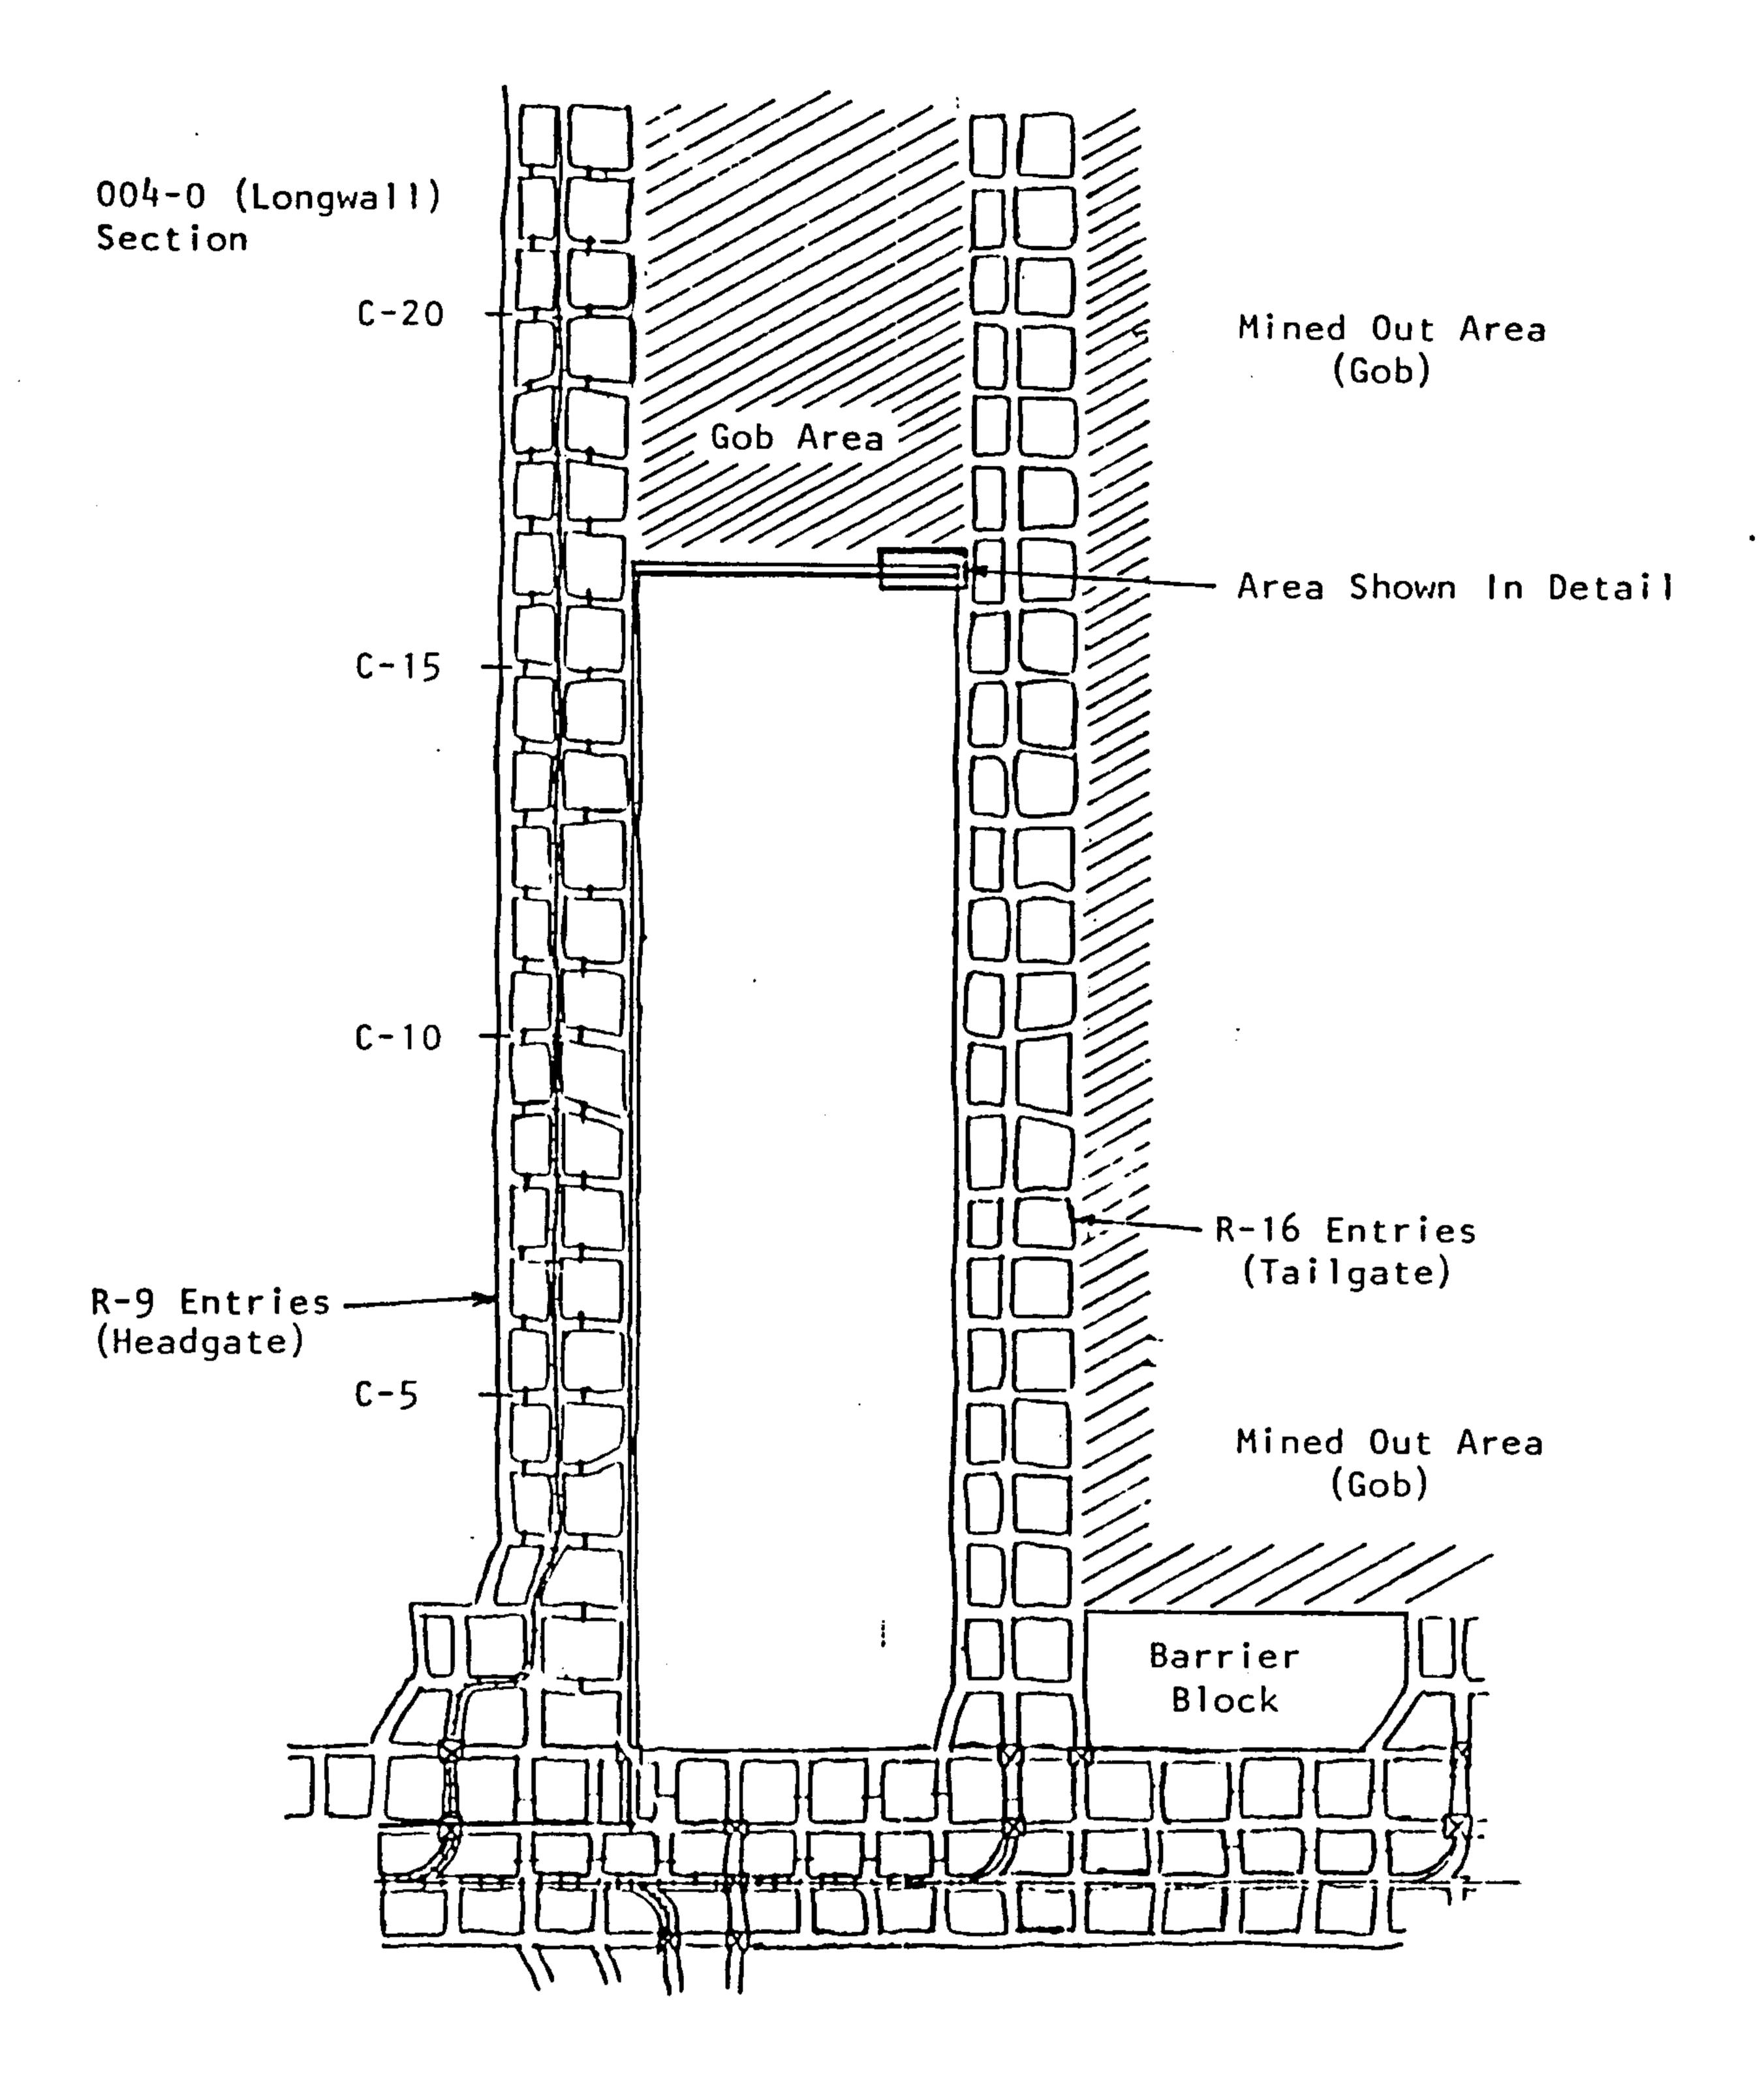


NONFATAL COAL OUTBURST ACCIDENT
NO. 37 MINE, (I.D. NO. 15-04670)
ARCH OF KENTUCKY, INC.
CUMBERLAND, HARLAN COUNTY, KENTUCKY
MAY 8, 1989

Scale: 1'' = 400'

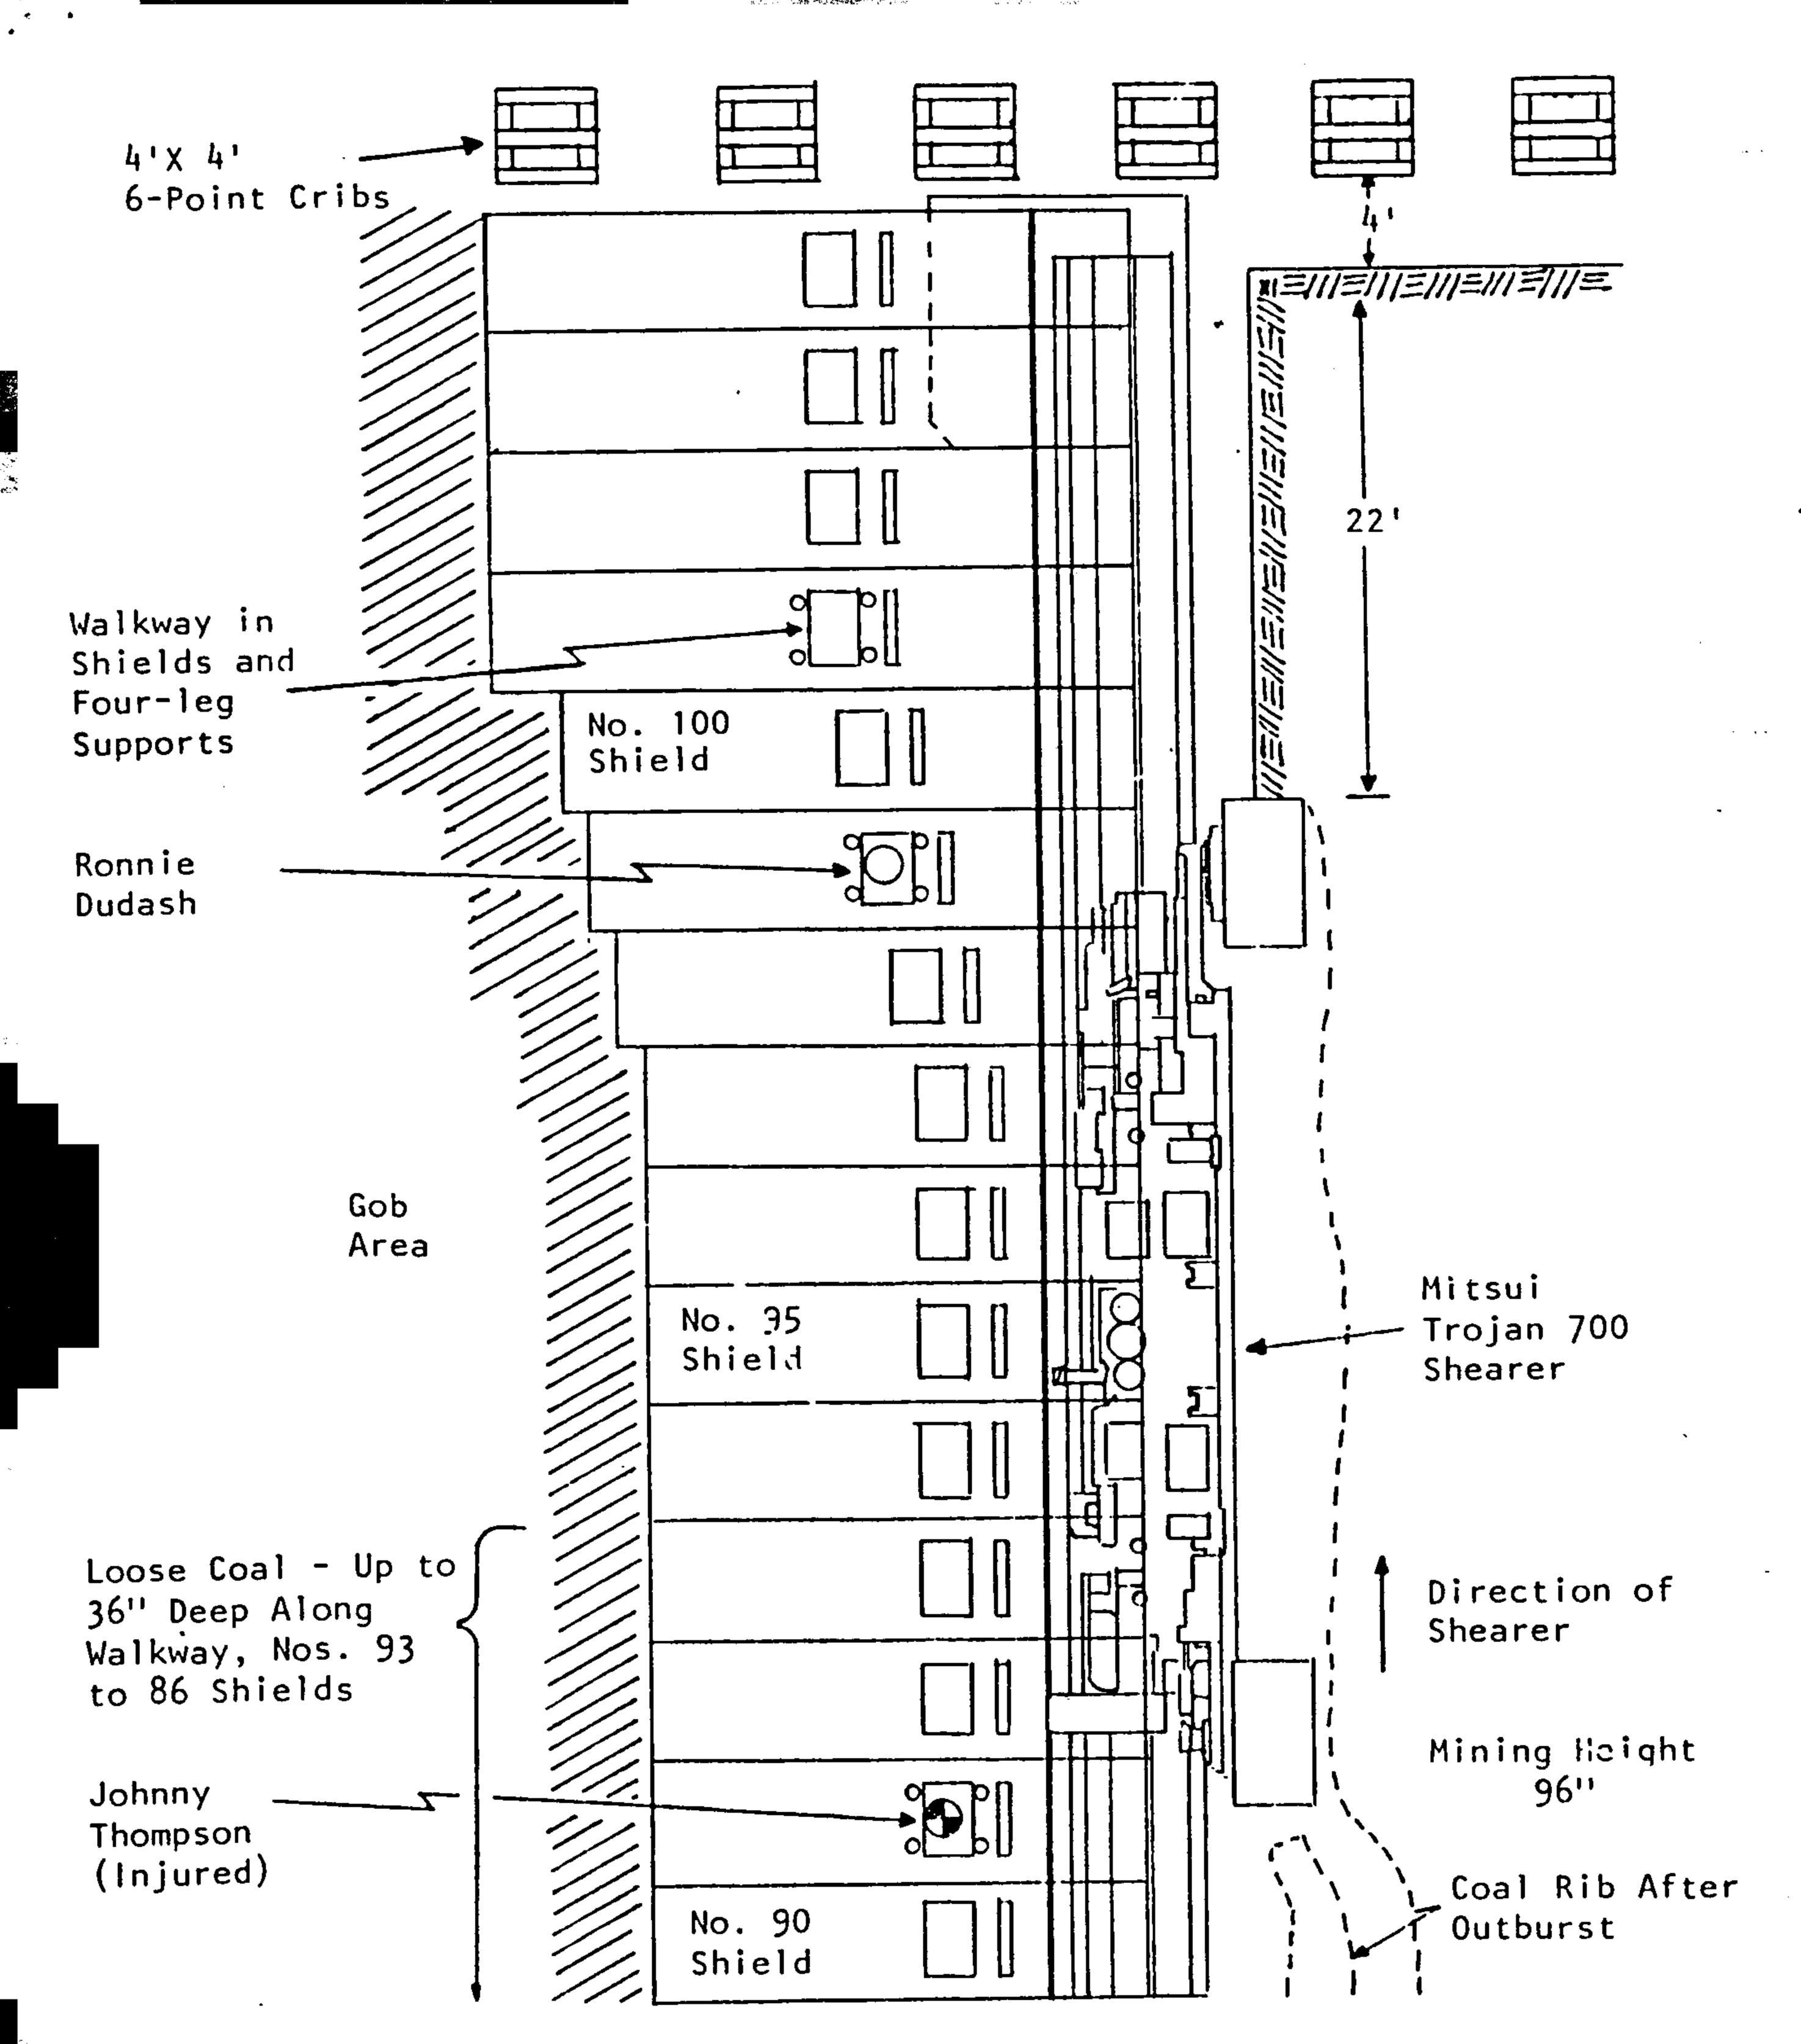


Sketch Number 2

NONFATAL COAL OUTBURST ACCIDENT
NO. 37 MINE (I.D. NO. 15-04670)
ARCH OF KENTUCKY, INC.
CUMBERLAND, HARLAN COUNTY, KENTUCKY
MAY 8, 1989

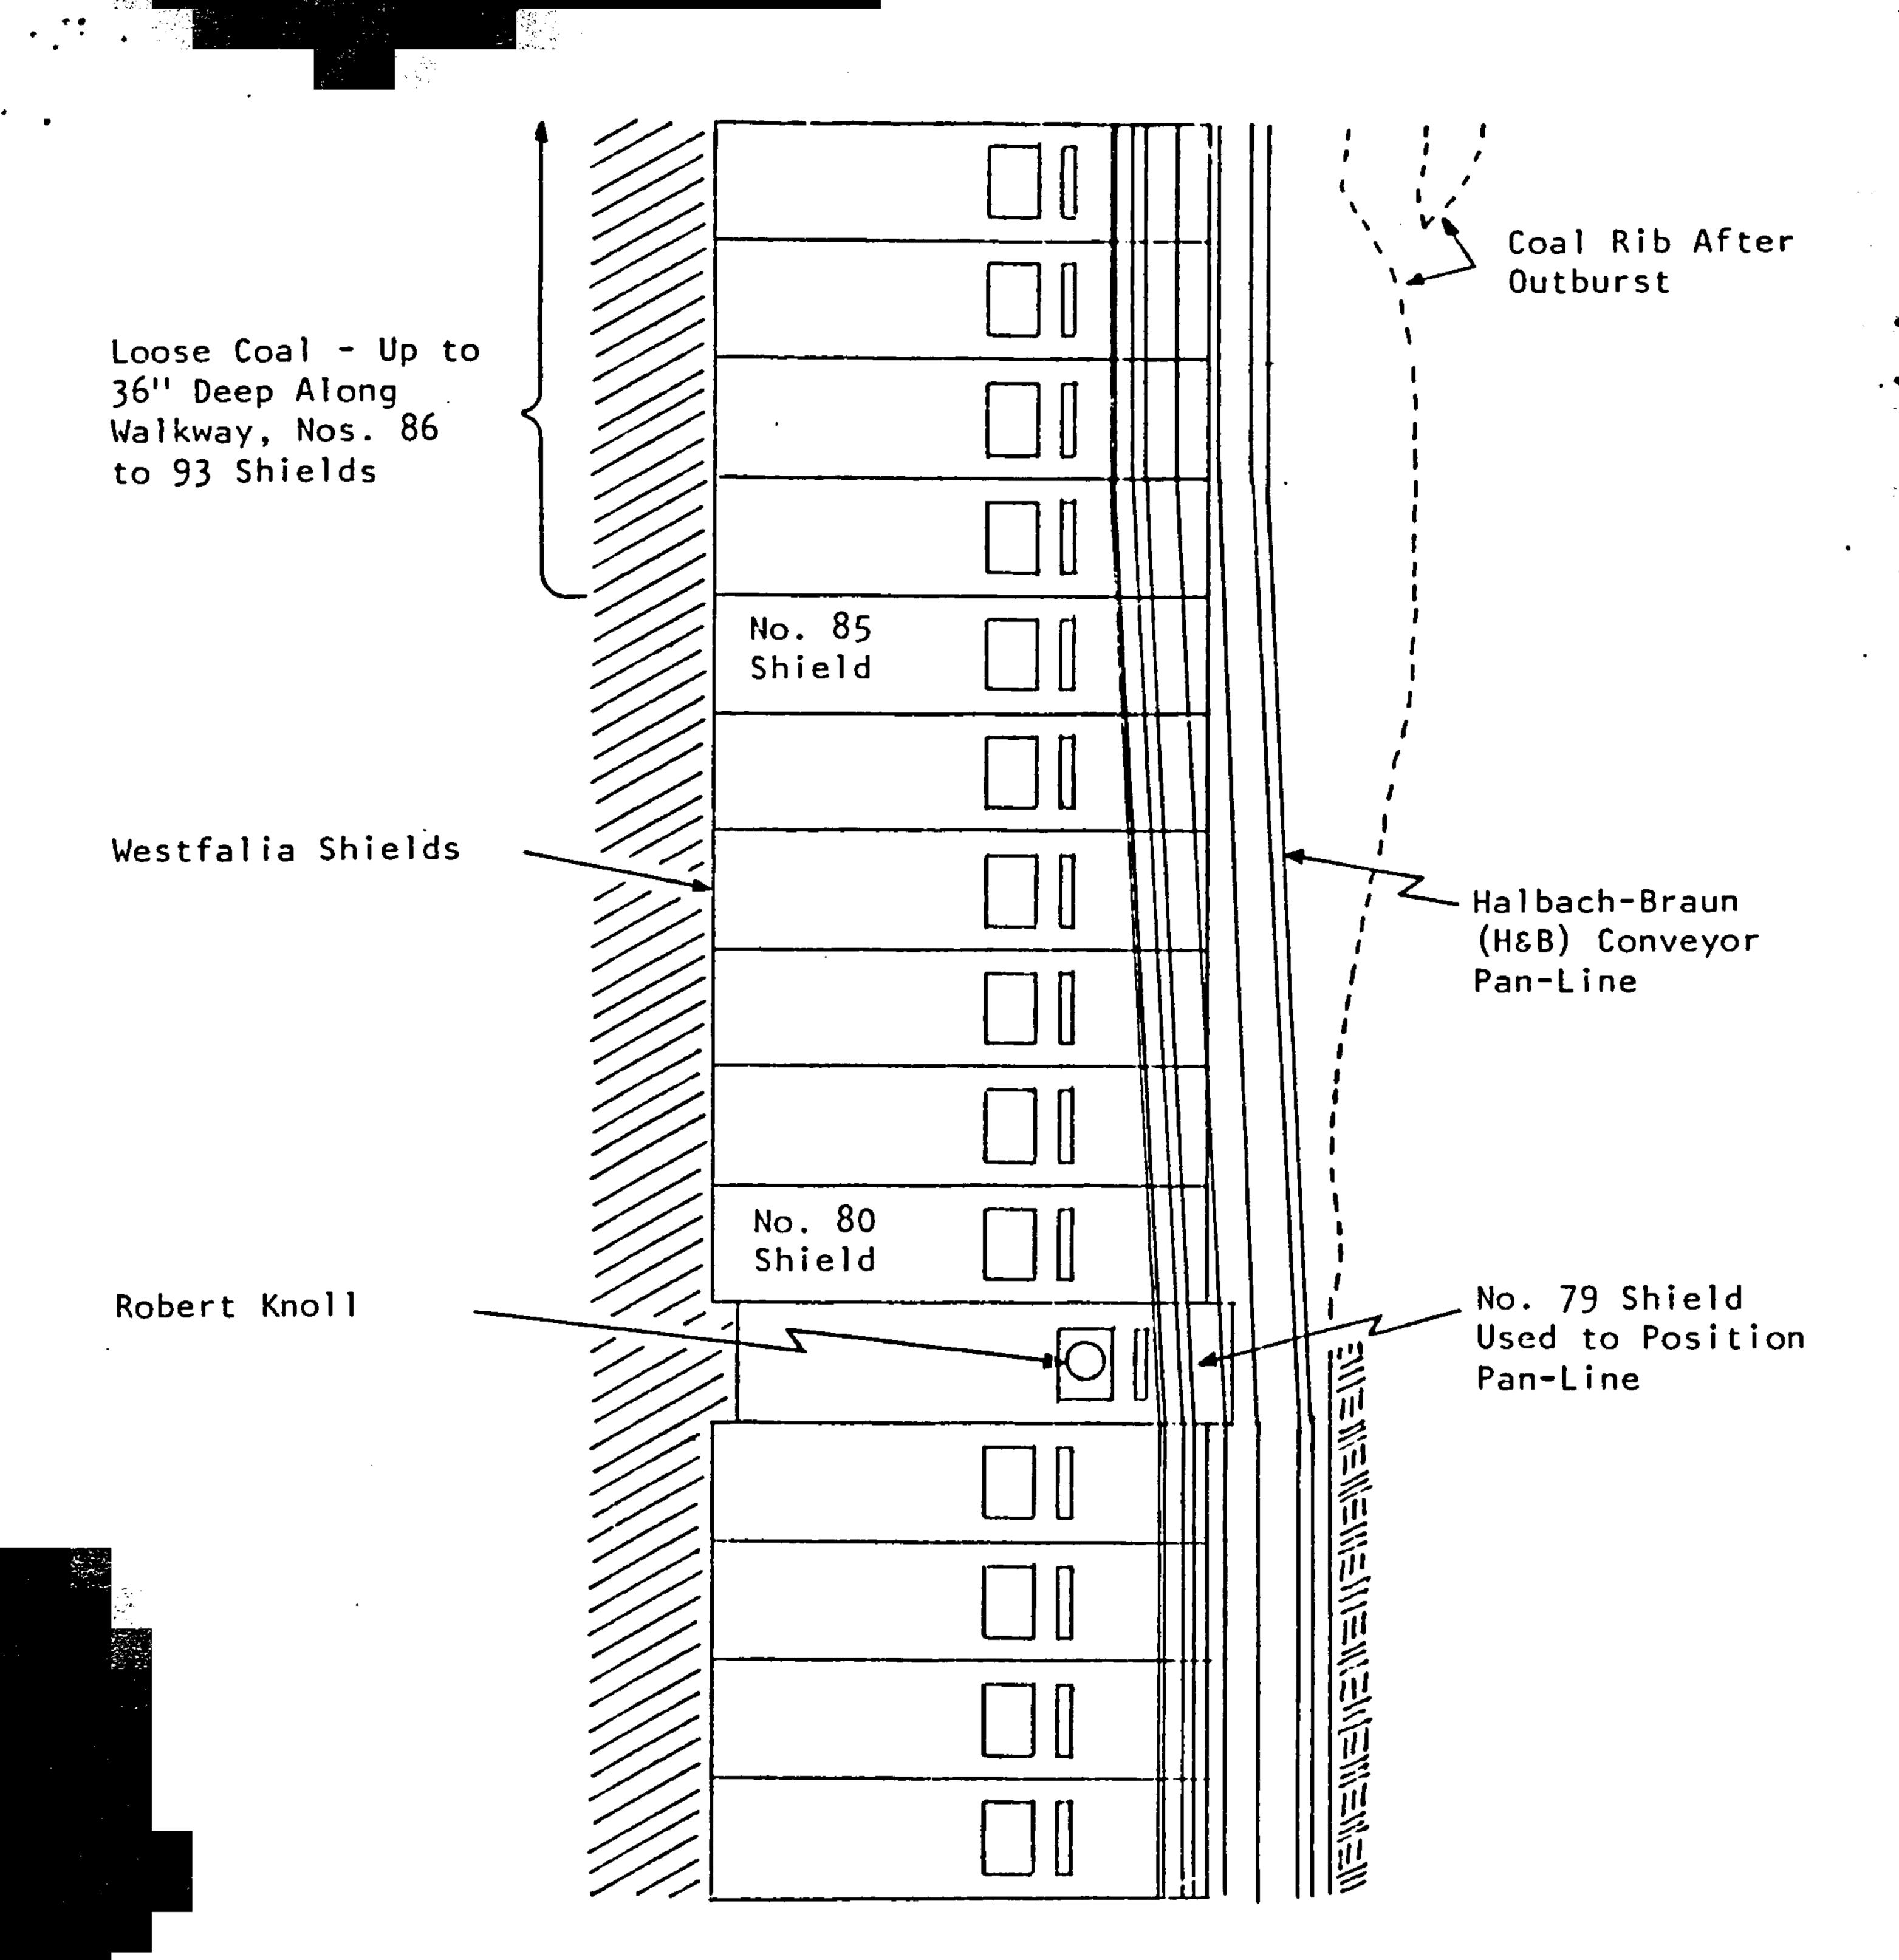


Sketch Number 3

NONFATAL COAL OUTBURST ACCIDENT
NO. 37 MINE (I.D. NO. 15-04670)
ARCH OF KENTUCKY, INC.
CUMBERLAND, HARLAN COUNTY, KENTUCKY
MAY 8, 1989

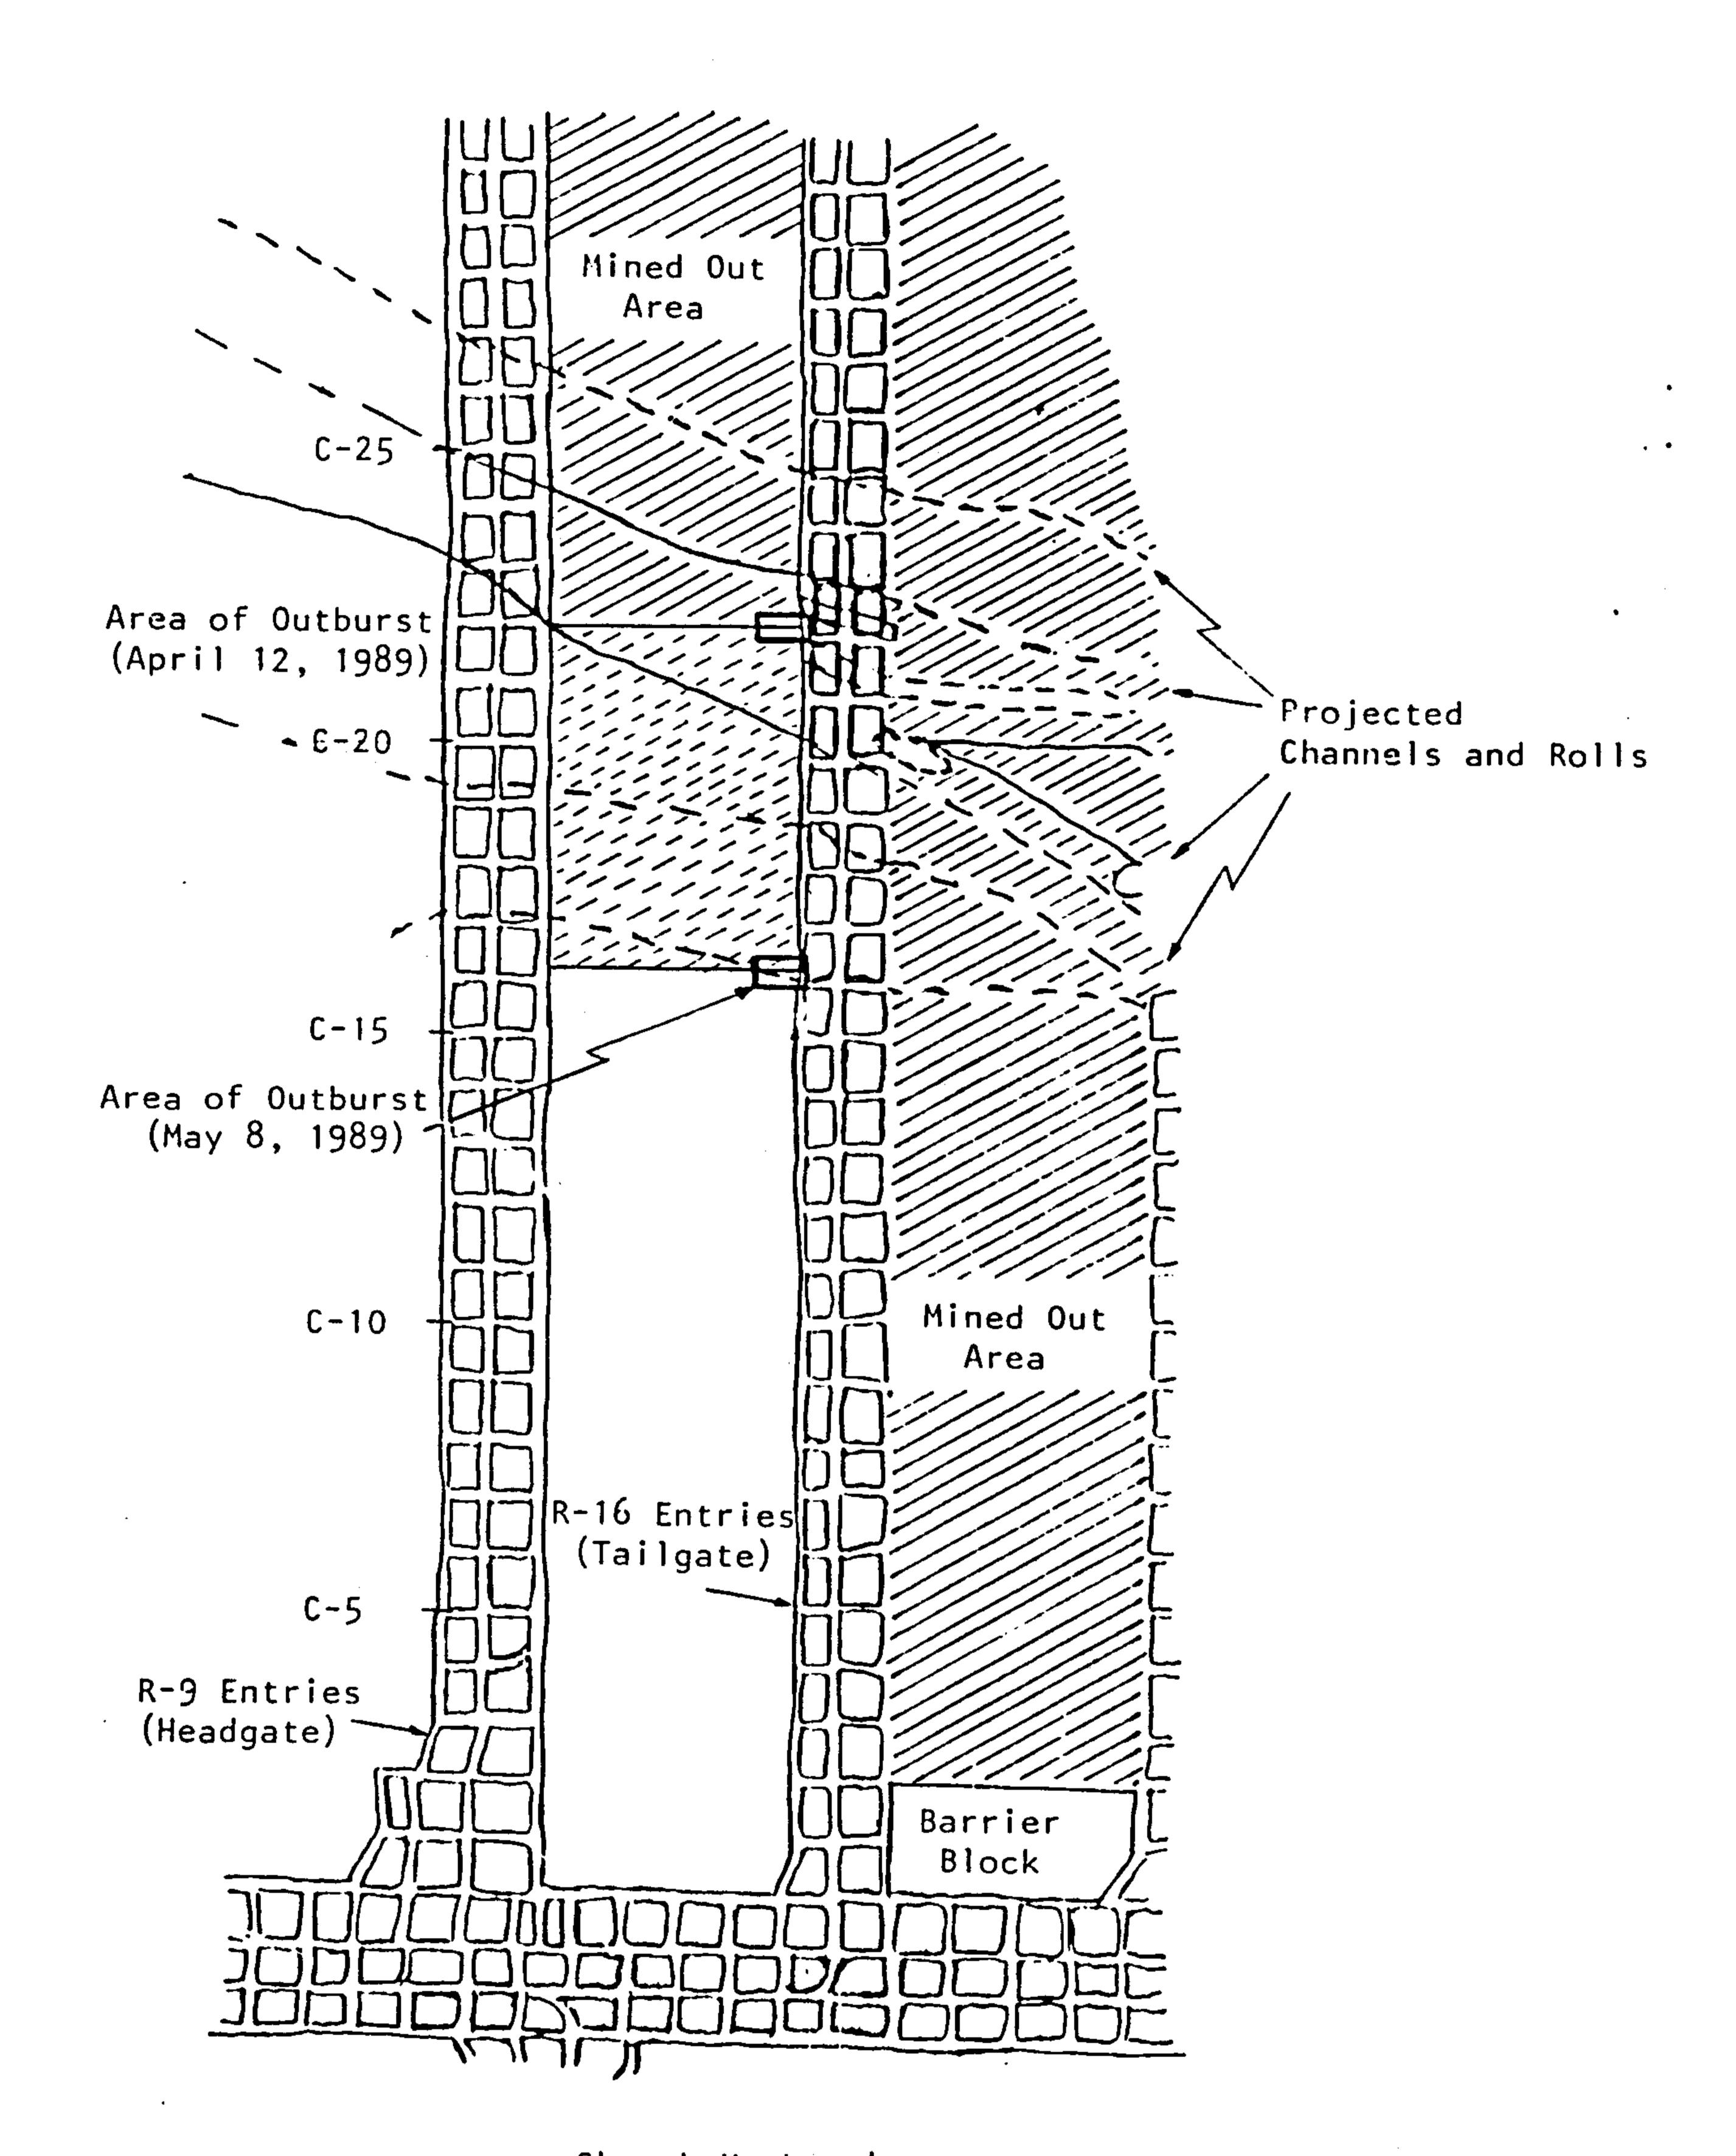

NONFATAL COAL OUTBURST ACCIDENT
NO. 37 MINE (I.D. NO. 15-04670)
ARCH OF KENTUCKY, INC.
CUMBERLAND, HARLAN COUNTY, KENTUCKY
MAY 8, 1989

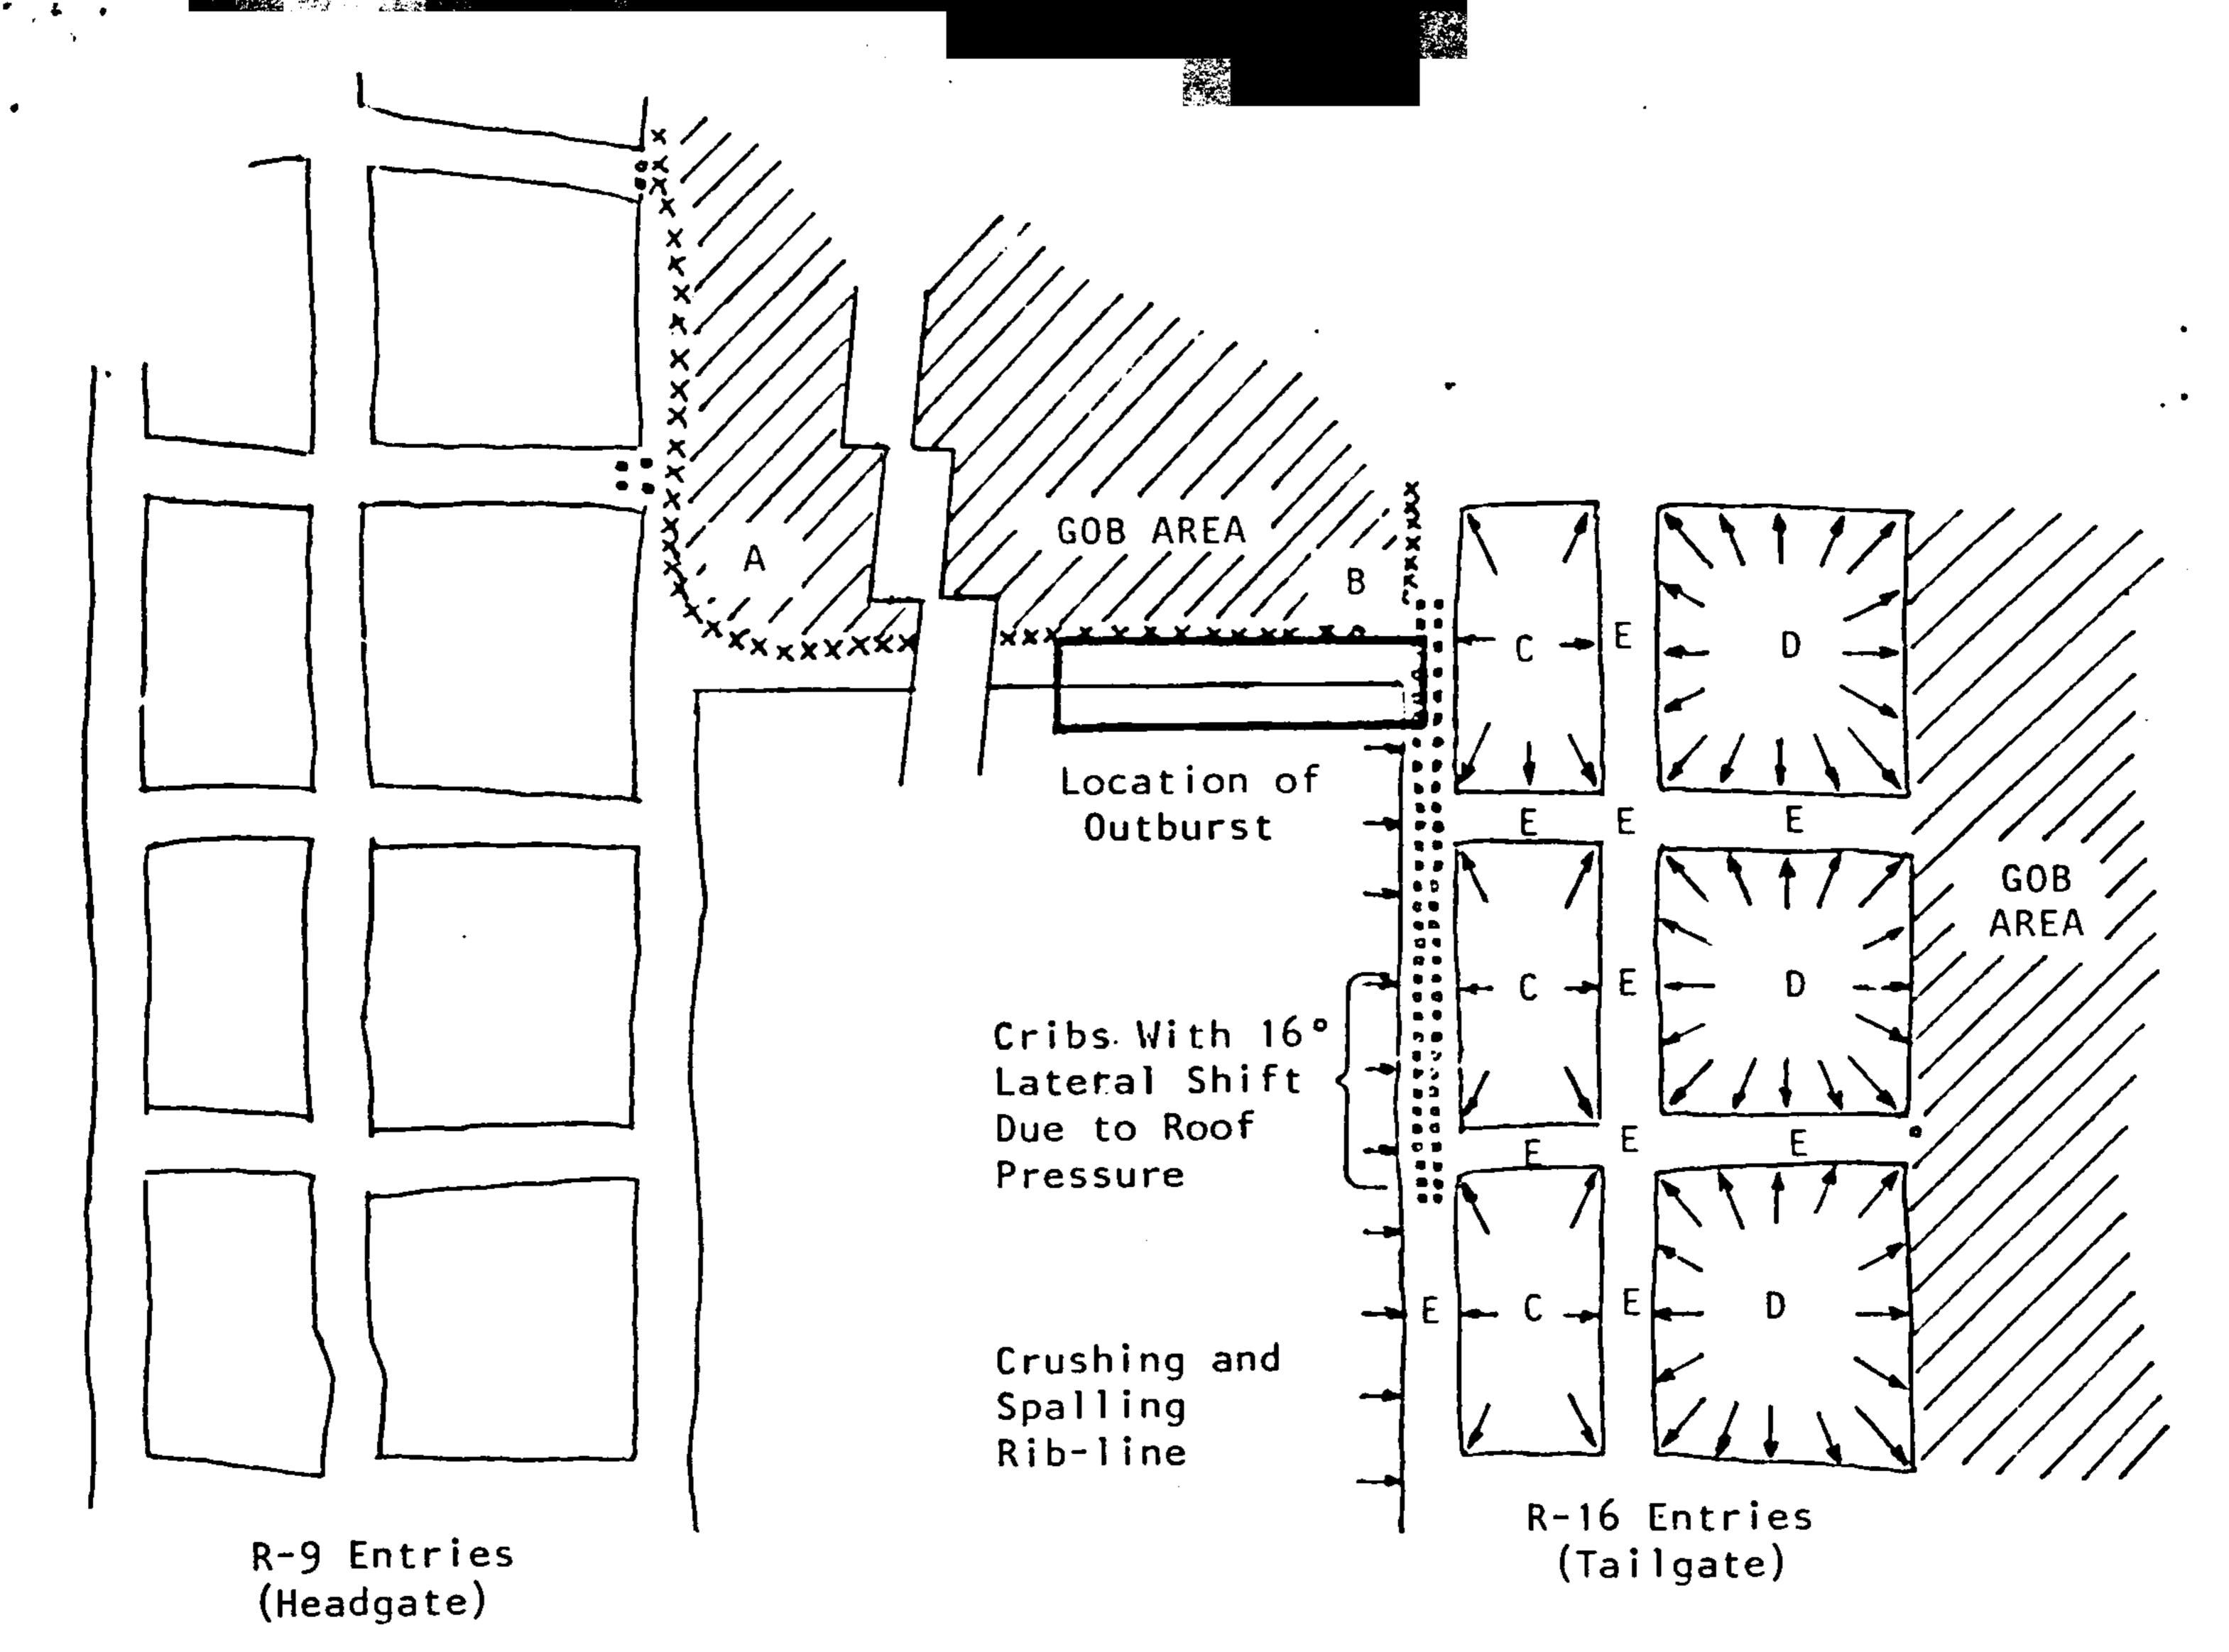

Legend

2 - 4'X 4' 6- Point Wooden

Cribs

A - Caved to approximately 14'

B - Caved to approximately 12'

C - Partially crushed pillars


D - Completely crushed pillars

E - Floor broken and heaved

Sketch Number 5

NONFATAL COAL OUTBURST ACCIDENT NO. 37 MINE (I.D. NO. 15-04670) ARCH OF KENTUCKY, INC. CUMBERLAND, HARLAN COUNTY, KENTUCKY MAY 8, 1989

> Not To Scale Not To Scale

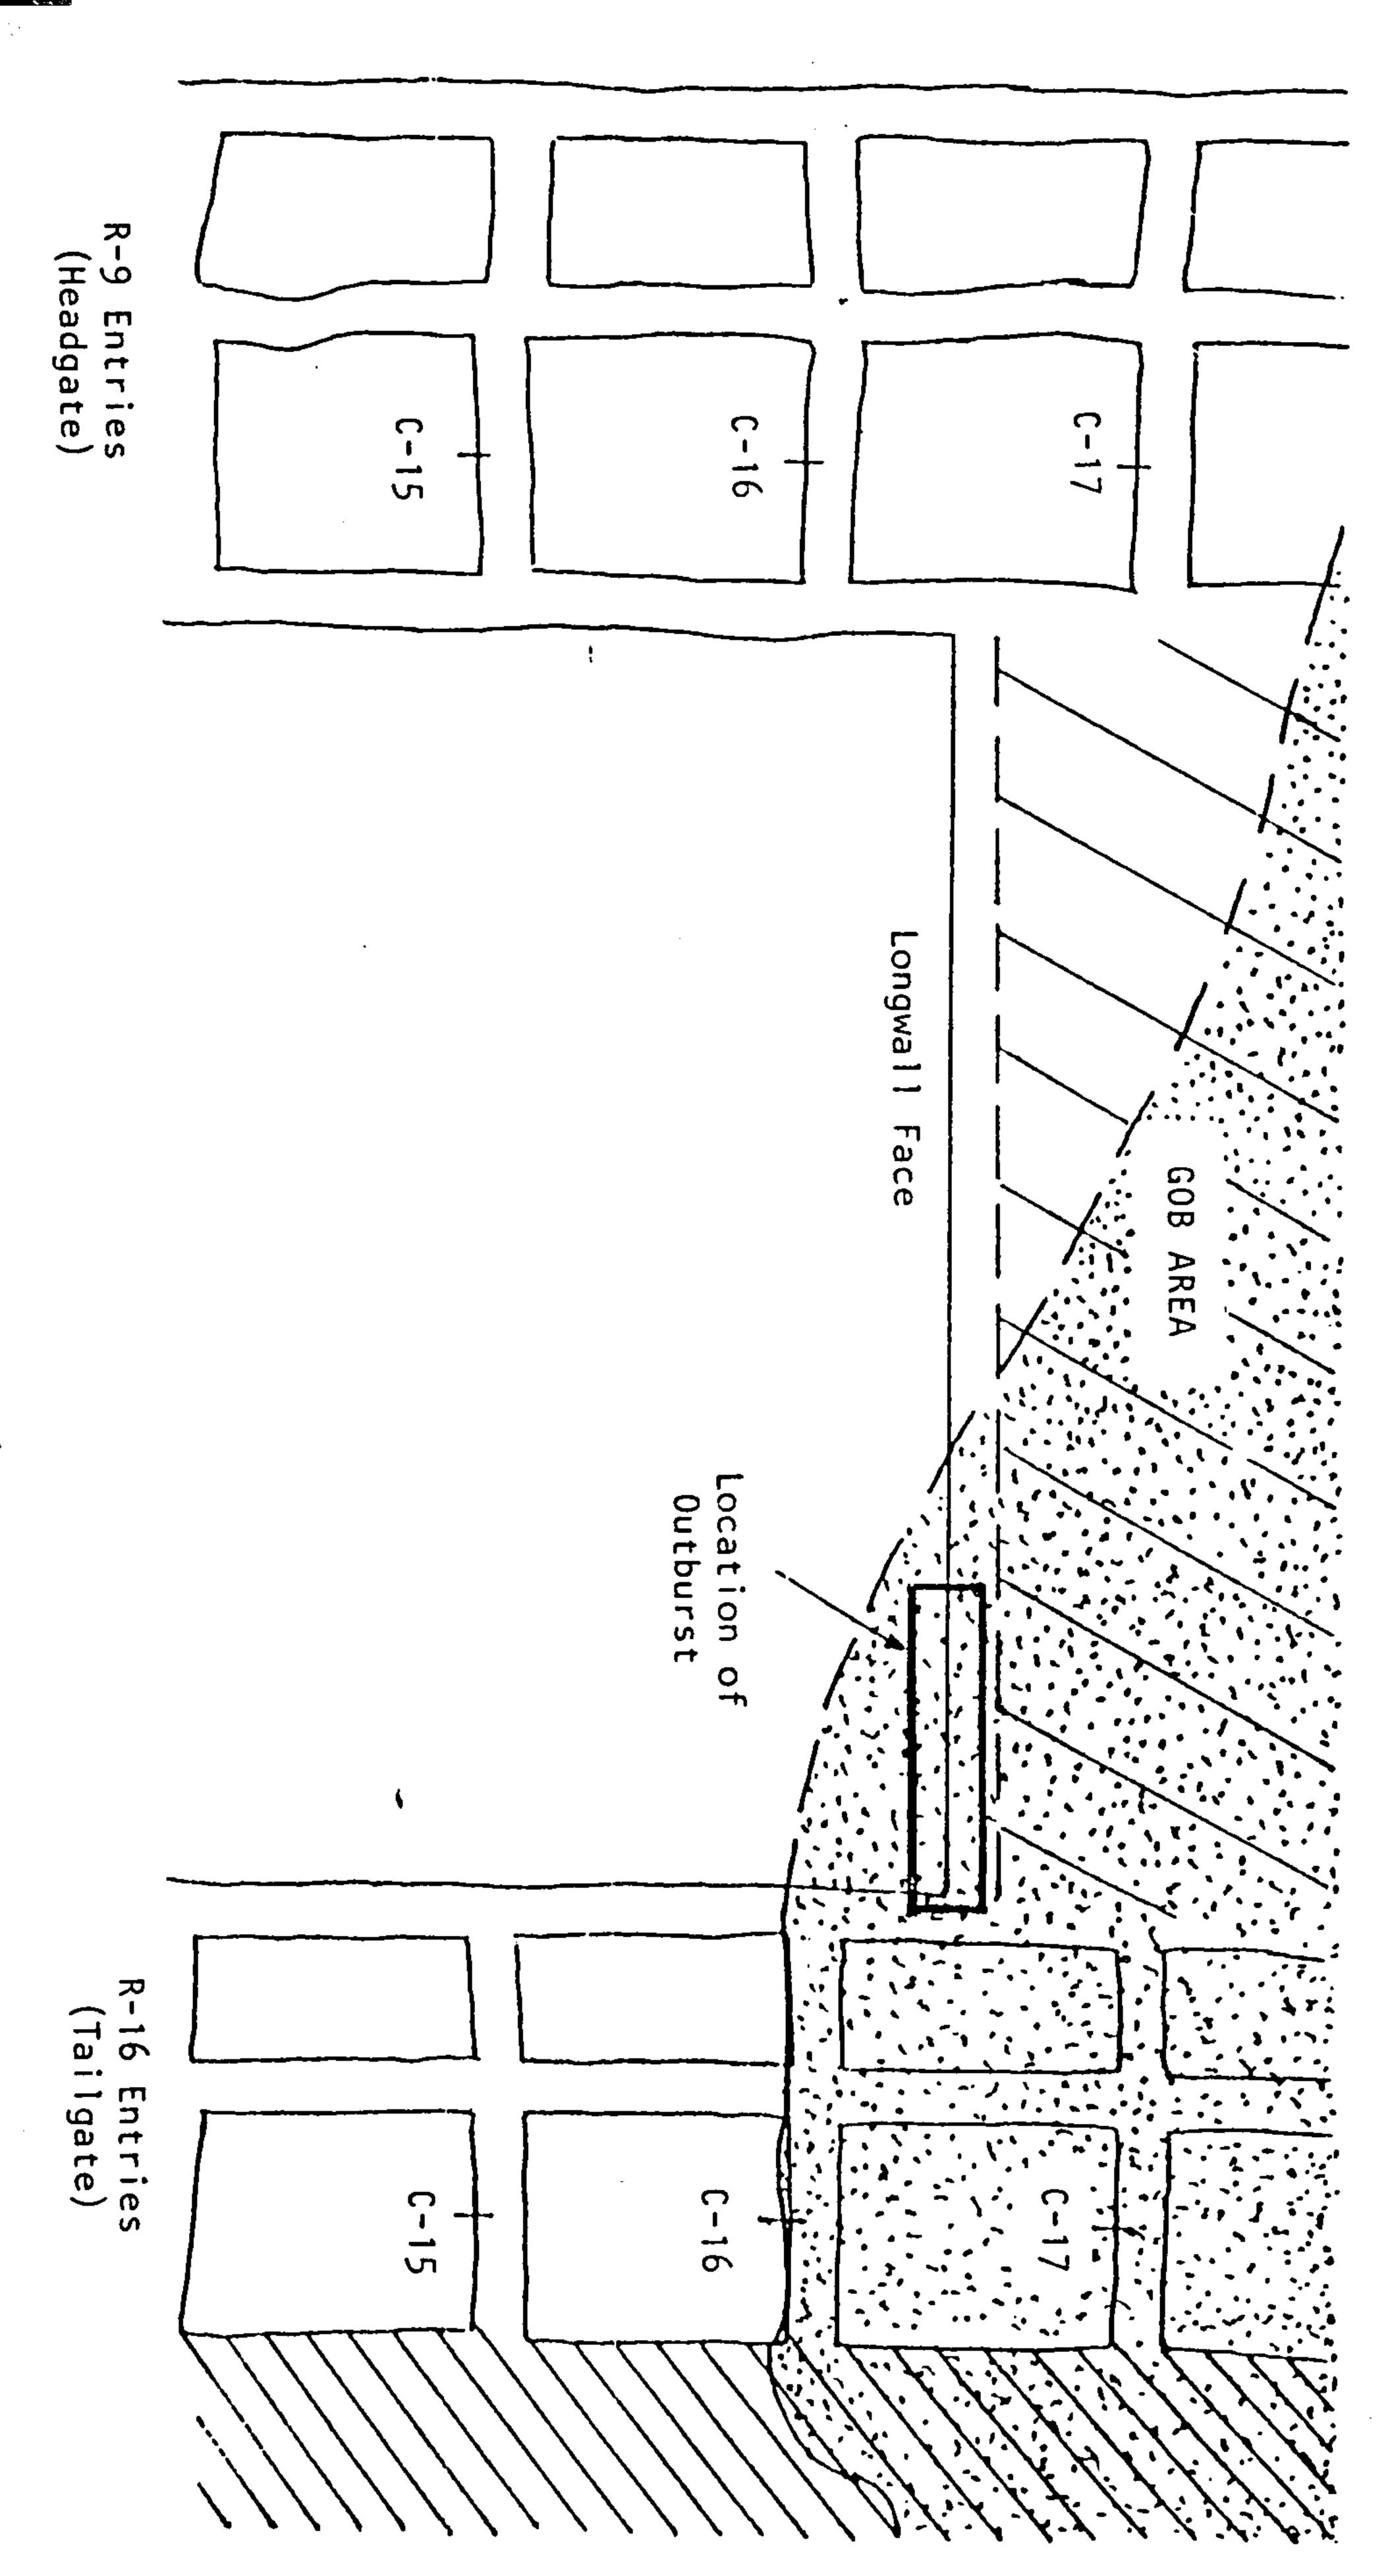

Sketch Number 6

NONFATAL COAL OUTBURST ACCIDENT
NO. 37 MINE (I.D. NO. 15-04670)
ARCH OF KENTUCKY, INC.
CUMBERLAND, HARLAN COUNTY, KENTUCKY
MAY 8, 1989

Legend

- Projected Roll

Mined Out Area (R-16 to R-22)

